

# Citroën C4 - Advarselslampe for kølevæsketemperatur lyser | HELLA

**Citroën C4 Alle modeller fra 18. september 2006**  
**Motorcode: NFU (TU5JP4)**  
**Advarselslampe for kølevæsketemperatur lyser**  
Hvis advarselslampe for kølevæsketemperatur begynder at lyse i ovennævnte modeller, kan årsagen være en defekt kølevæskesensor. Evt. kan fejlkoden: P0116 ligge i fejlhukommelsen. Årsagen til forkerte måleværdier kan være en revne i kølevæsketempersensoren, eller at der er monteret en forkert kølevæsketempersensor. Bemærk: [Kontroller, om kølevæsketempersensoren har den korrekte specifikation (typebetegnelse) og mærkning (\*96566364\* producent Valeo)]. I tilfælde af ukorrekte måleværdier (se Tekniske Data / side 2) skal fejlen afhjælpes ved at montere en ny, ændret kølevæsketempersensor.  
**Kølevæsketempersensor: Reservedelsnummer: 1338.F8**  
**Hella kølevæsketempersensor: 6PT.009**  
**309-221**  
**Tempersensor - Tekniske Data – Værdier (Generelle informationer / disse værdier er ikke modelspecifikke)**  
**Tekniske data – værdier**  
**Temperatur Modstand**  
0 °C ca. 6000 ohm  
10 °C ca. 3500 ohm  
20 °C ca. 2500 ohm  
40 °C ca. 1200 ohm  
60 °C ca. 600 ohm  
80 °C ca. 300 ohm  
100 °C ca. 180 ohm

**C4**

**All models from 18 September 2006**

**Engine code: NFU (TU5JP4)**

If there are complaints about the illumination of the coolant temperature warning light on the above mentioned vehicles, the coolant temperature sensor is to be considered as a possible source of the fault.

The fault code: P0116 may be logged.

A crack in the measuring element of the coolant temperature sensor may be responsible for the fault, or an incorrect coolant temperature sensor may have been fitted.

Note:

[The coolant temperature sensor is to be checked for the correct specification [(type identifier) marking (\*96566364\* manufacturer Valeo)].

If the measured values are incorrect

(see Technical data / page 2.)

a new, modified coolant temperature

sensor must be fitted to rectify the fault.


Coolant temperature sensor:

Service part number (ET): ET no.: 1338.F8

Hella coolant temperature sensor: 6PT.009 309-221

Temperature sensor - technical data – approximate values

(general information / these figures are not model-specific)

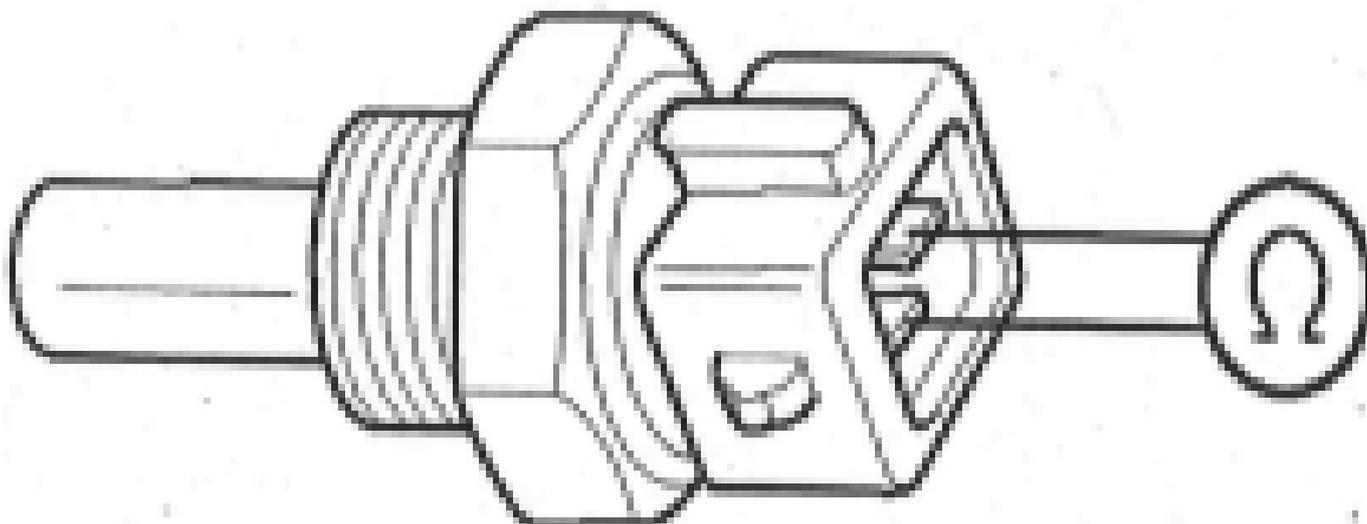

Temperature