



VW T5 - kølemiddeltermostat

Datablad	
Producent	Volkswagen
Model	Transporter T5
Motor	1,9 TDI
Årgang	2006 - 2009
Symptom	Kølevæsketermostat




Driftstemperaturen er ikke nået Termostat og kølevæskeflange

I de ovennævnte modeller kan det ske, at driftstemperaturen ikke nås. Nogle gange viser temperaturdisplayet i kombiinstrumentet en "kold motor".br/>> Årsagen findes ofte i termostaten, som ikke lukker ordentligt.br/>> Termostaten sidder på motorblokken bag generatoren.br/>> Når kølevæskeflangen er fjernet, kan termostaten fjernes sammen med tætningsringen.br/>> Før den nye termostat monteres, skal kølevæskeflangen kontrolleres.br/>> Ofte brækker en del af plastføringen (monteringshjælp) af her.br/>> Så er det en god idé at udskifte flangen.



Kølevæskeflange T5

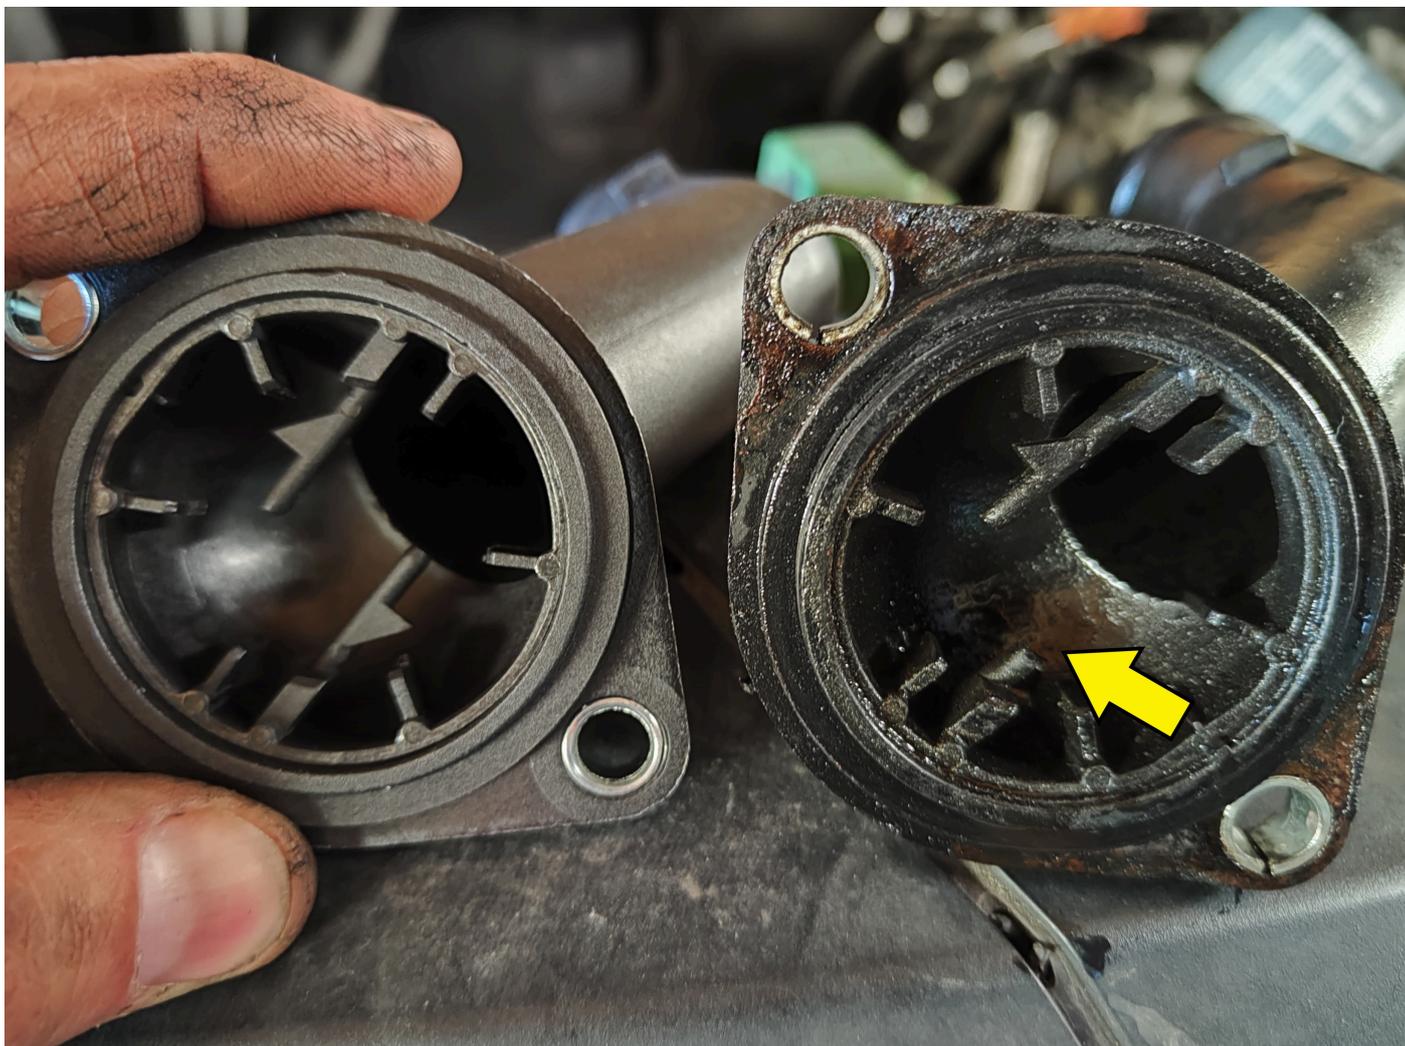

Plastføring T5 kølevæskeflange

ⓘ Important safety note

The following technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for suitably qualified personnel only.

ⓘ IMPORTANT

Please always follow the repair instructions from the vehicle manufacturer when carrying out such work!



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.