

Opel Astra H - Koudemiddelverlies | HELLA

Opel

Astra H

Bouwjaar: 2002 - 2009

Koudemiddelverlies

Condensor beschadigd en lek

Als bij bovengenoemde voertuigen een koudemiddelverlies wordt vastgesteld, moet speciale aandacht aan de condensor worden geschonken.

Door uitgevallen lamellen treedt er instabiliteit in het condensornet op. De trillingen kunnen vervolgens tot contact met andere onderdelen leiden. Hierdoor wordt de condensor beschadigd (afbeelding 1) en kan deze lek raken.

Verder is het mogelijk dat de condensor uit zijn bevestiging losraakt en tegen de drager komt te liggen (afbeelding 2). Dit kan eveneens tot lekkage leiden.

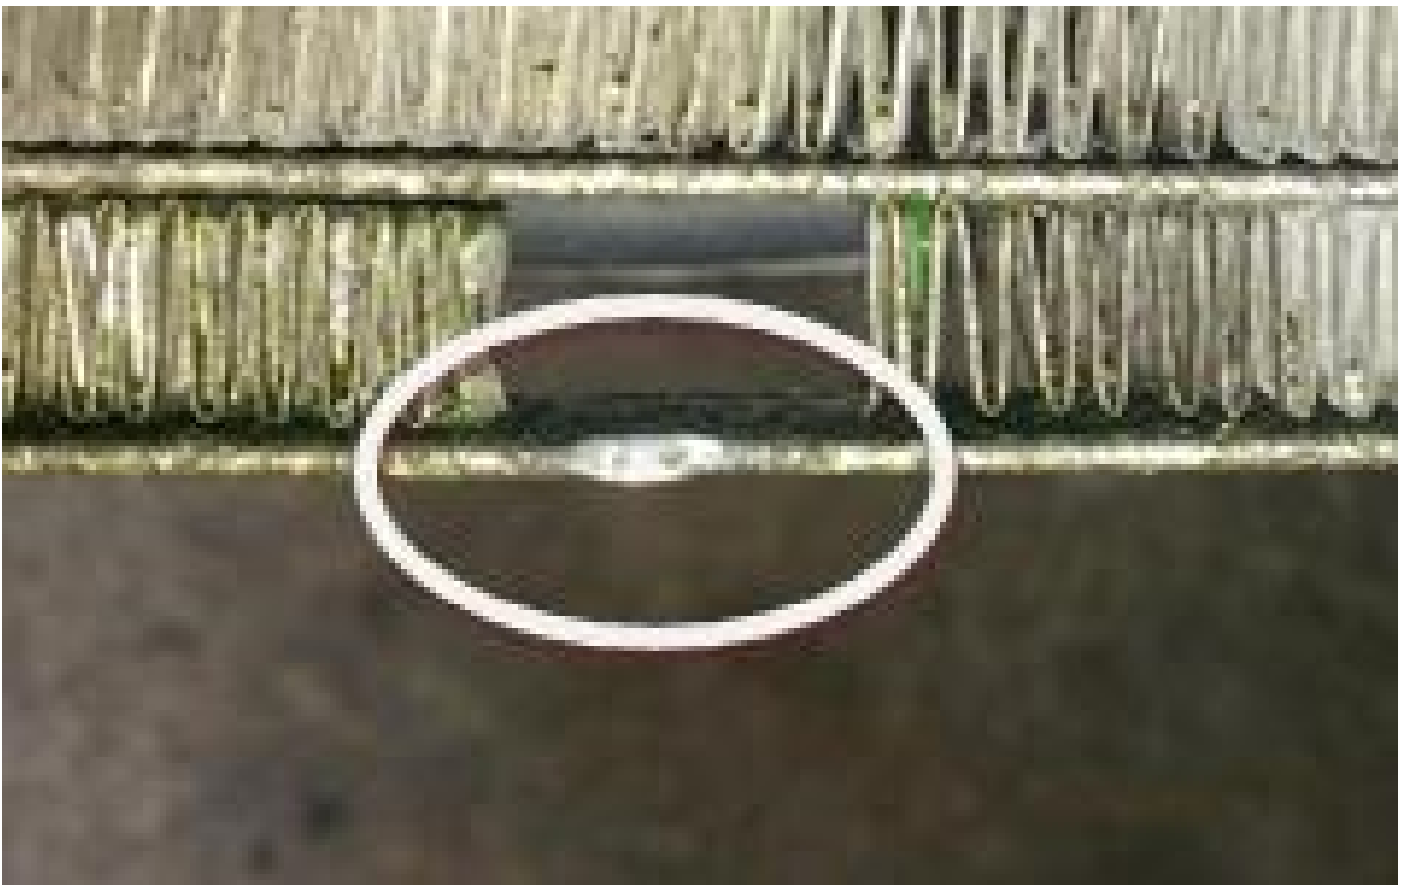




Figure 2

ⓘ Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.