

Suzuki Alto - Value displayed on coolant temperature gauge is too low | HELLA

Suzuki

Alto

All models: 2002 to 2007

Value displayed on coolant temperature gauge is too low.

If these vehicles display an irregular coolant temperature value, the possibility of a bad ground connection to the thermostat housing bracket must be considered. To fix this problem, the ground cable (see figure) should be connected between the thermostat housing and the thermostat housing bracket.

Additionally, check the thermostat housing for damage and replace if necessary.


Spare part: (spare parts) - number:

1 unit: Thermostat housing: 17690M79F20

Spare parts: (spare parts) - number:

1 unit: Ground cable: 39313M82020

1 unit: Fastening bolt: 02142M05123

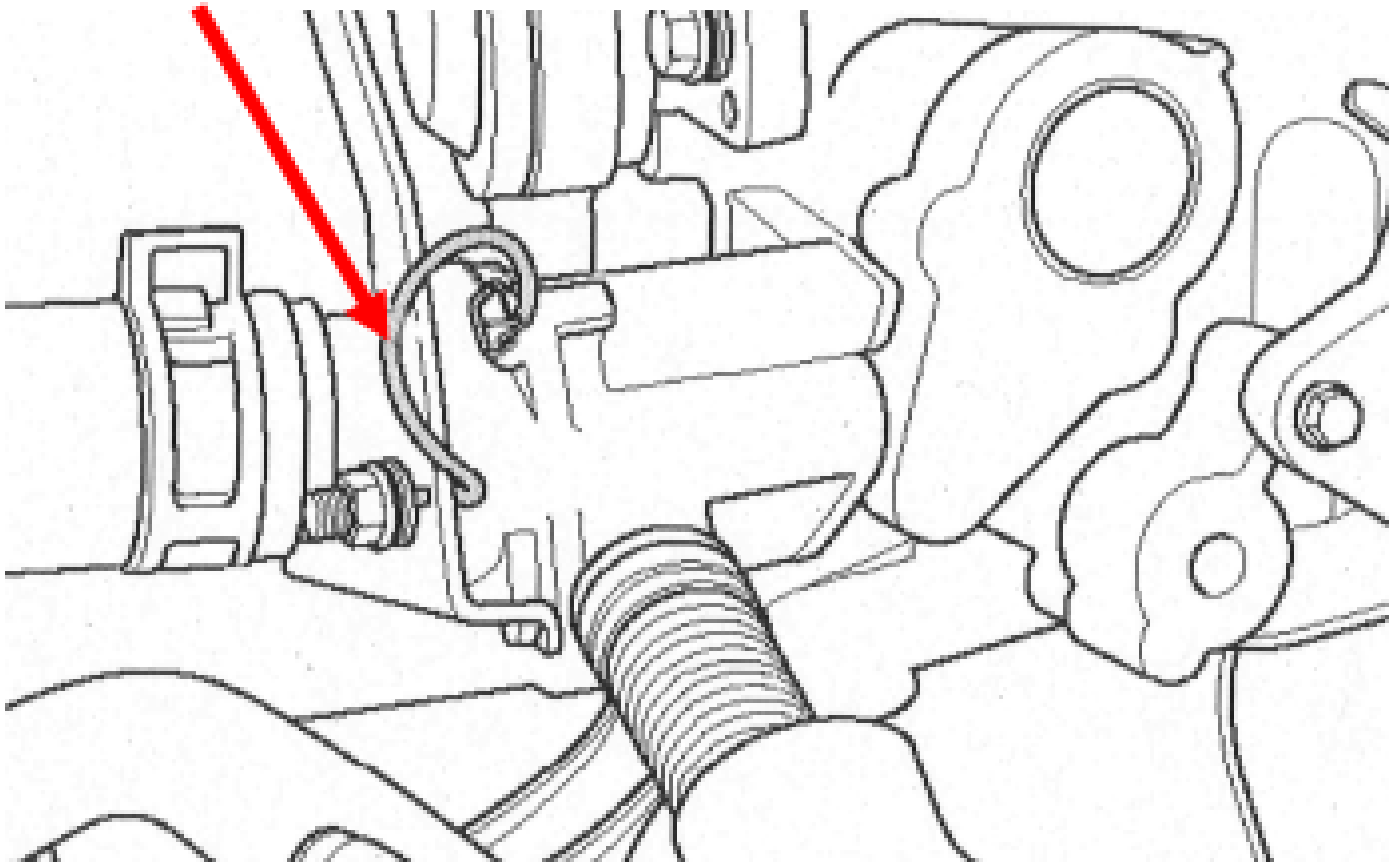

ⓘ Important safety note

Technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for use by suitably qualified personnel only. Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval and indication of the source. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.