



Volvo XC 40 - replacing the pollen filter/cabin air filter

Data sheet	
Manufacturer	Volvo
Vehicle model	XC 40
Engine	B4 2.0 16V
Engine code	B 420 T6
Year of manufacture	From 2019
Symptoms	Replacement of the pollen filter/cabin air filter
HELLA parts to replace	8ZC 366 122-331 / 8ZC 366 122-101

Important safety information

Repair instructions for the pollen filter/cabin air filter


When replacing the pollen filter/cabin air filter in the vehicle mentioned above, the following procedure should be followed.



- Open the glove compartment (1) and release the retaining straps (2) so that you can lower the glove compartment lid.
- By unlocking the locking tabs(3), you can remove the cover (4) to release the latch (5). The cover (6) can now be opened.


The filter (7) can now be removed and, once the filter compartment has been cleaned if necessary, replaced with the new part. Please ensure that the flow direction is correct and that the filter is seated properly.

ⓘ Please note

Please note that the spare part numbers listed may also be suitable for other models. Therefore please check the vehicle allocation.

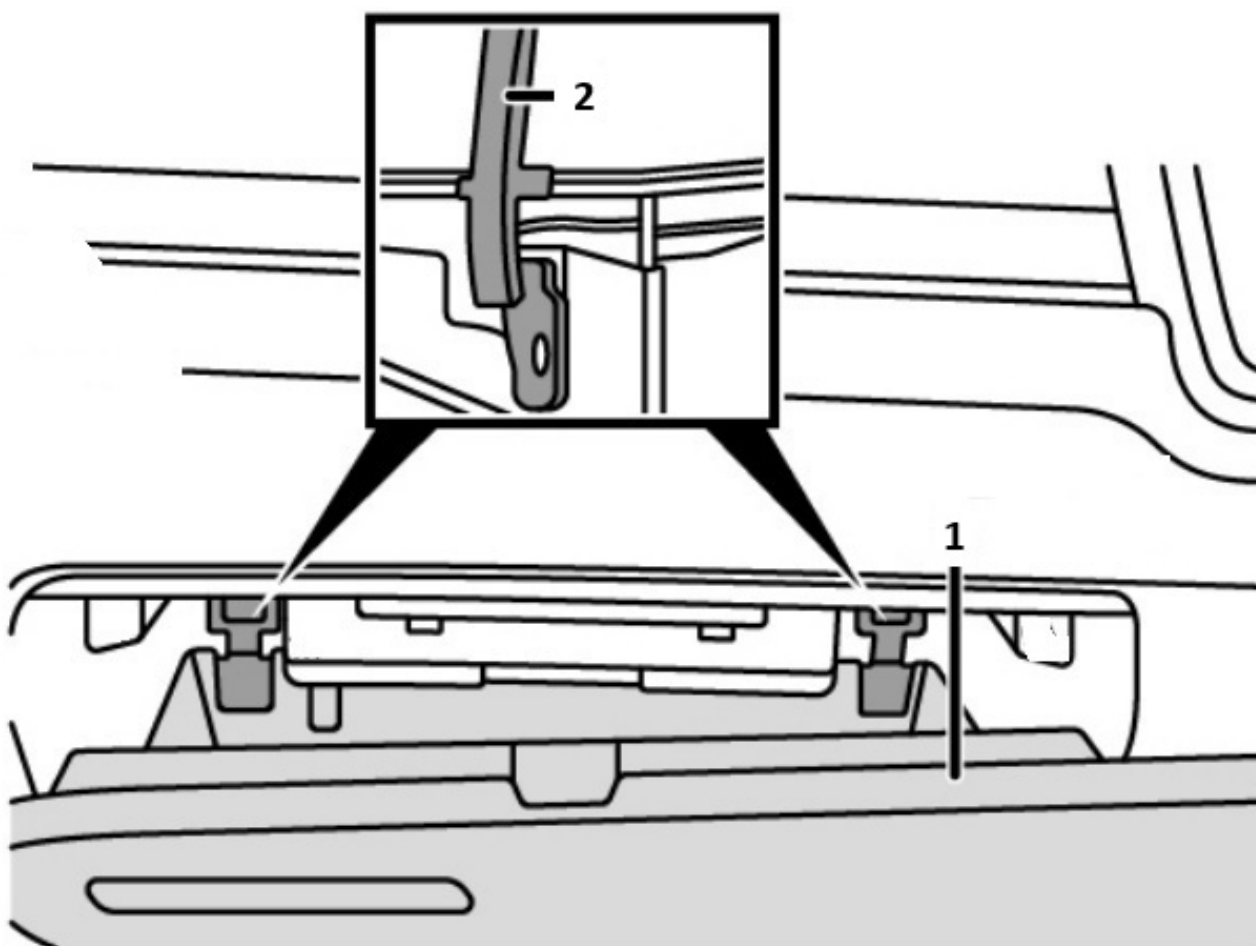

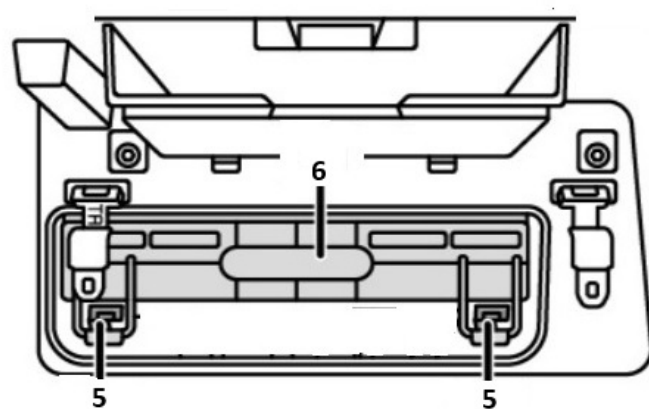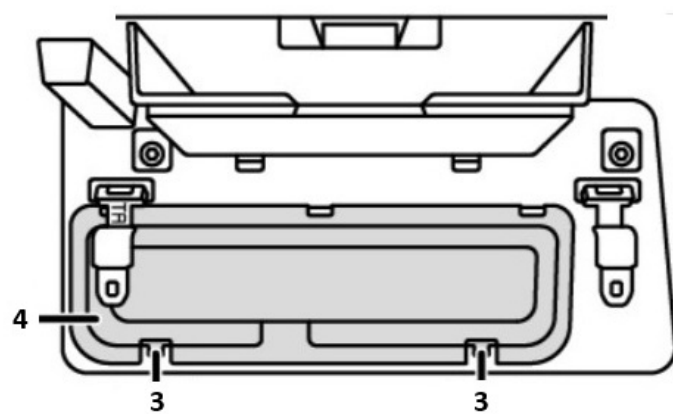

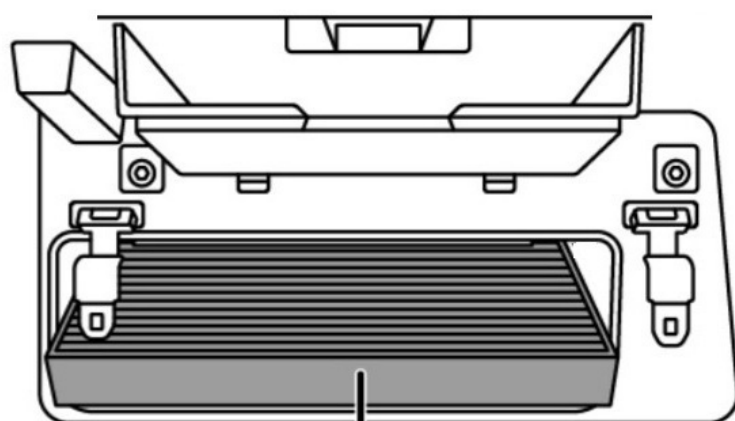

7