Bulletin




© Hella KGaA Hueck & Co., Lippstadt 26. Januar 2005 1-1

Saab 9-3

Vehicle locks and unlocks on its own, engine cannot be started.

If there are complaints with these vehicles that the central locking locks or unlocks of its own accord and that the engine cannot be started, one possible cause is a damaged cable. This cable is for the microswitch on the front door handle (see drawing). The cable may be trapped between the handle and the mounting bracket. The damage leads to faults in the central locking and the alarm system. To rectify the fault, the door handle must be removed, and the cable for the microswitch must be checked for damage. If the cable is damaged, the entire door handle including the microswitch should be replaced.

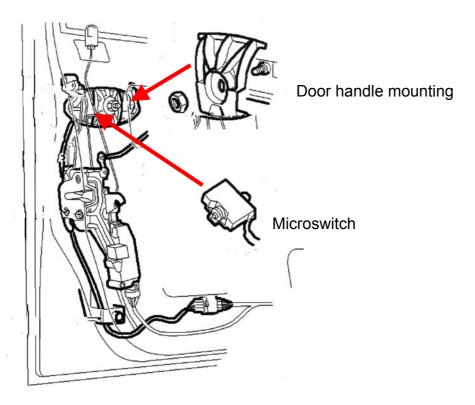

Bulletin

