

© Hella KGaA Hueck & Co., Lippstadt

23 February 2007

Audi Q7 With xenon headlights

Replacement of the light source.

In order to replace the light source of the headlight on this vehicle model, proceed as follows (The description is based on the headlight on the passenger side):

• Switch off the lighting and the ignition.

Low beam:

- Unlock the headlight housing. To do this, pull up the lock (Fig. 1) and press the snap-fit tab (Fig. 2) down. Remove the cap for access to the high-beam bulb by turning (Fig. 3), unlock the connection cable and disconnect it. The headlight can now be completely removed.
- Unlock the rear cap by pushing, and remove it (Fig. 4).
- Release the xenon bulb complete with the igniter by turning the lock (Fig. 5), and remove it from the headlight. The xenon bulb can now be replaced complete with the igniter (Fig. 6) (only complete replacement is possible).
- Refit removed parts in reverse order. Caution: When inserting the headlight, make sure that the top guides (Fig. 6) and side guides (Fig. 7) on the headlight grip in the guides of the frame.

High beam:

The headlight does not have to be removed to replace the high-beam bulb. Access is gained by removing the cap (Fig. 3).









2-2

© Hella KGaA Hueck & Co., Lippstadt

23 February 2007

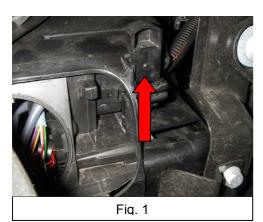
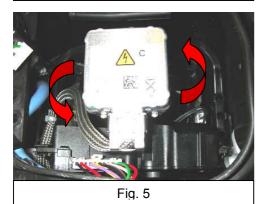
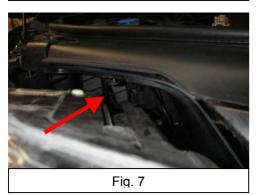


Fig. 3





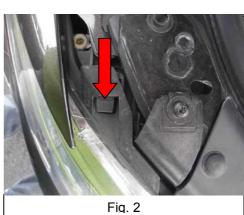




Fig. 4

