



## **BMW 3 Series (E46) All vehicles with fog lights**

### **Fog lights illuminate poorly**

If there are complaints about the above-mentioned fault, the cause could be corroded reflectors. Heavy and permanent fogging can give rise to the formation of corrosion in the fog lights (see Fig. 1). Due to this, the luminous efficiency of the light is critically reduced and the above-mentioned complaint arises. In this case, the complete fog light must be replaced. As an alternative to the original light, the Hella Micro-DE fog light can be installed (part no. 1NL 008 090-031). This is a particularly good idea, as the Hella lights fit into the openings for the original lights (see Fig. 2).



Fig. 2

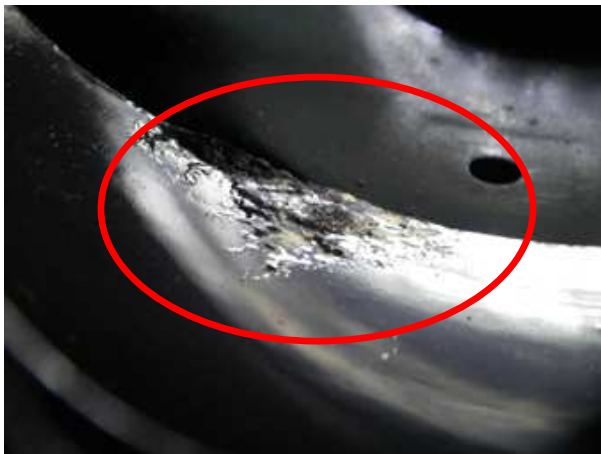


Fig. 1