

Lancia Musa - Motorcontrolelampje brandt | HELLA

Lancia

Musa

Alle modellen:

Chassisnummer: 1039844 – 1047932

Motorcode:

188A9.000

188B2.000


Motorcontrolelampje brandt.

Als bij deze auto's wordt geklaagd, dat het motorcontrolelampje (MIL) brandt en ook de storing P0180 in het storingsgeheugen is opgeslagen, is een mogelijke oorzaak een slecht contact van de brandstoftemperatuursensor.

De storingscode P0180 duidt op de betreffende storing: "stroomkring, kabelboom, brandstoftemperatuursensor, motorbedieningsapparaat".

Verder dient het brandstoffilterhuis te worden gecontroleerd op de productiedatum (zie foto/label, gestreepte pijl). Als de datumcode 2835 is, moet het brandstoffilterhuis worden vervangen.

u>Brandstoffilterhuis:/u>

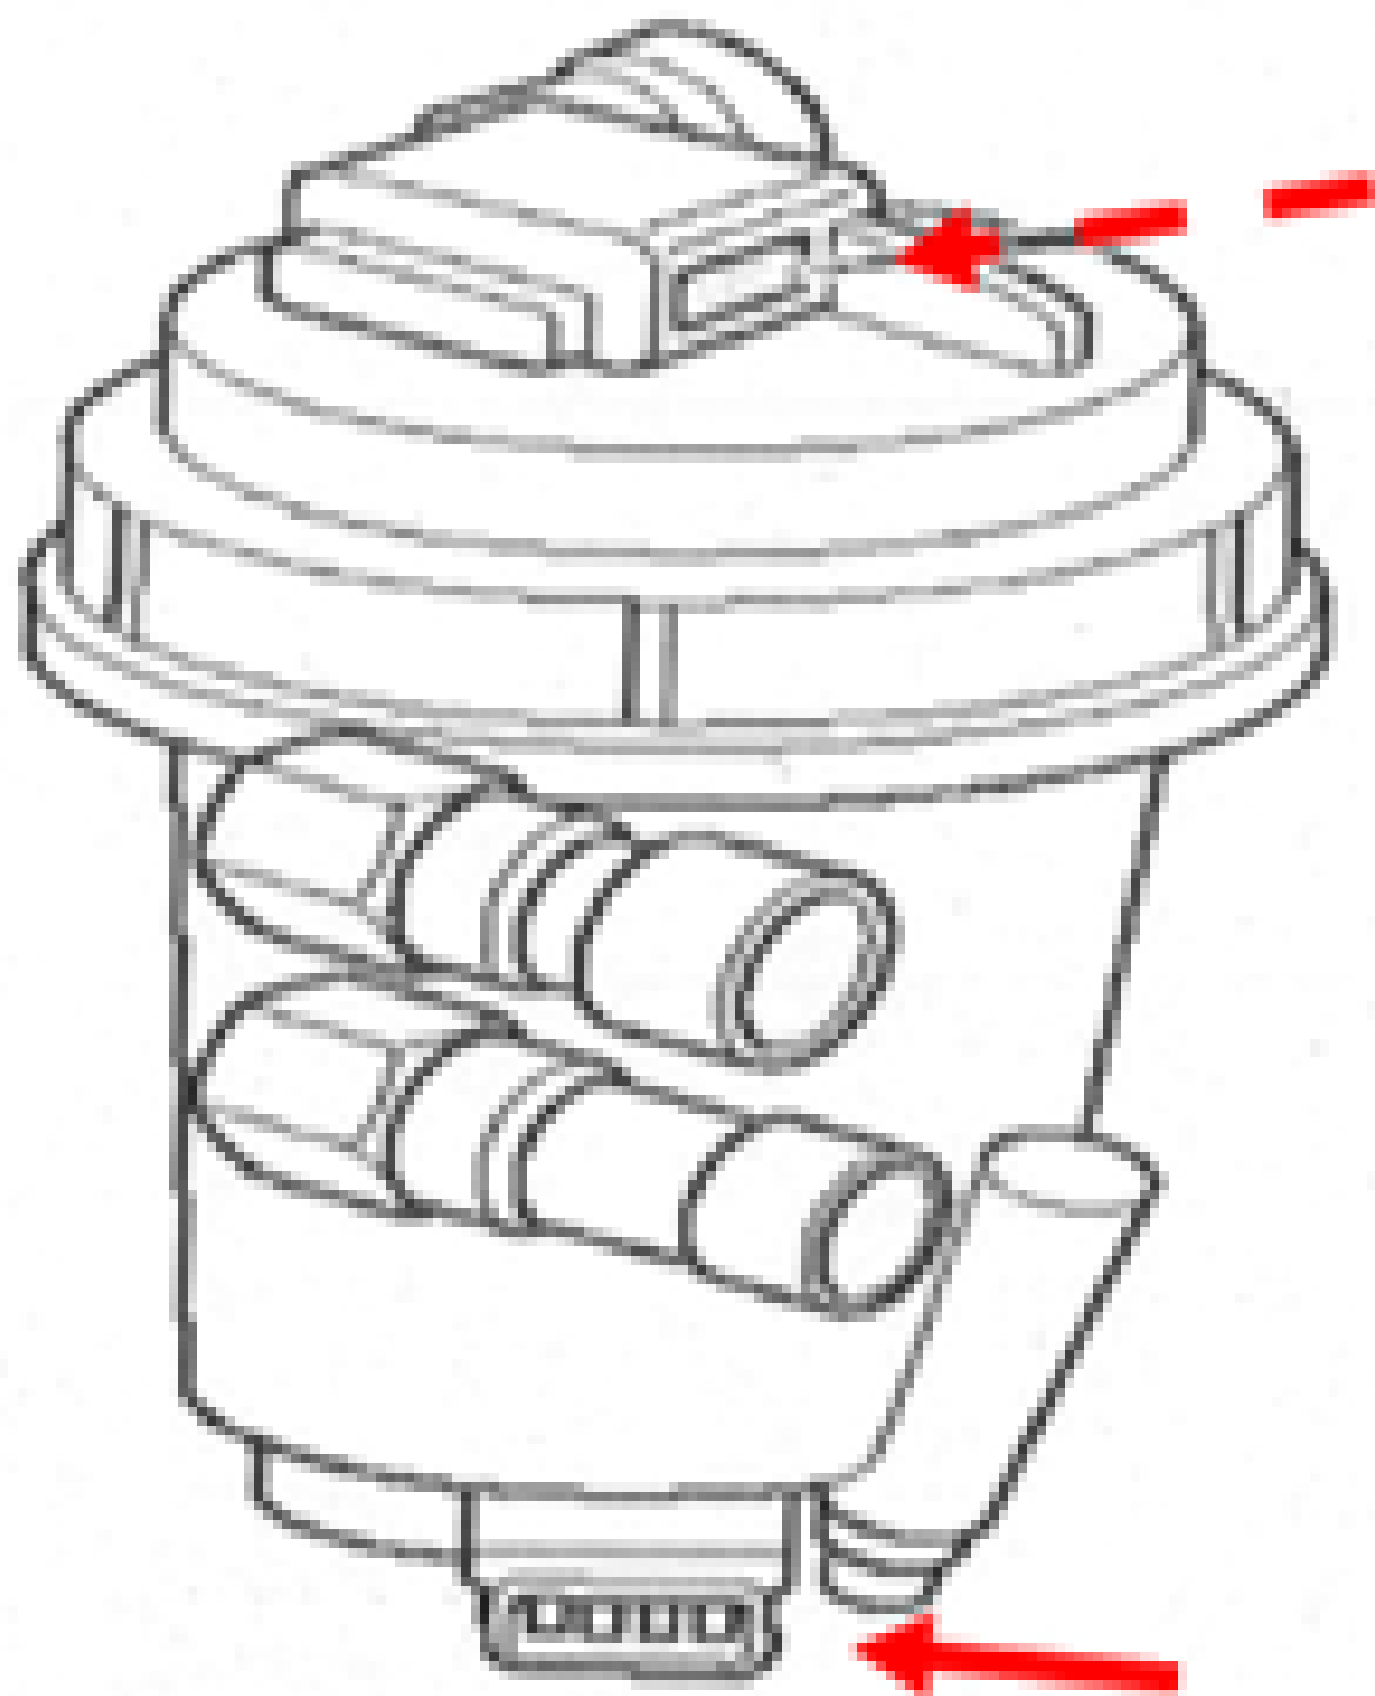

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.