

Peugeot 206 - Engine malfunction indicator light is on | HELLA

Peugeot

206 1.6 HDI


Model year from 2005–2007

Engine code DV6TED4 (9HZ)

Engine malfunction indicator light is on

If a customer complains about the above error, this could be caused by a defective plug contact on the air flow sensor. The customer may also complain that the engine goes into limp home mode and that it has no power. Furthermore, various error codes can be displayed in connection with the air flow sensor. In this case, the wiring harness with plug must be installed using a repair kit with OE article number 6569Q9.



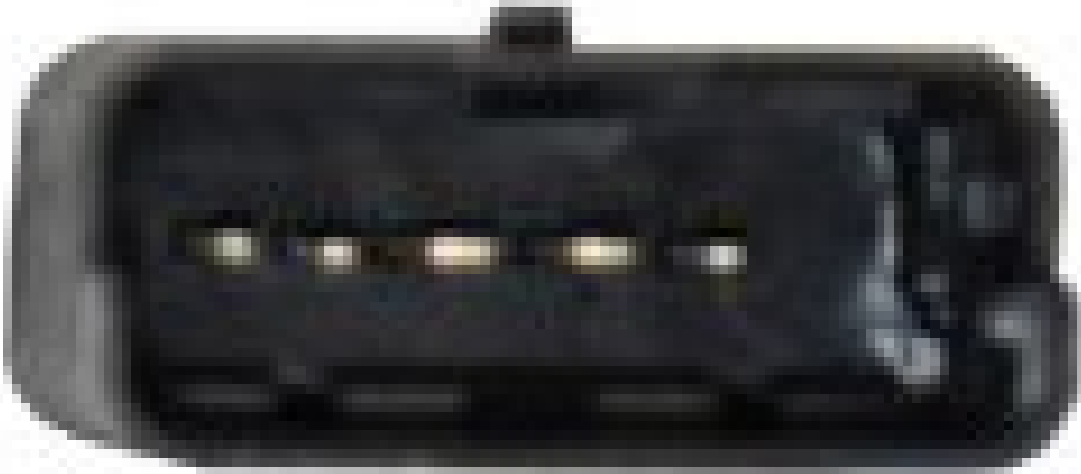

Caution!

The wiring harness in the repair kit has different coloured cables than the cable set installed at the factory. Make sure that you connect the cables correctly during assembly.

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.